

19246

2002-04 Ford Focus 2.0L DOHC Vin 5

- Subject:** Broken Front Converters
- Model(s):** Focus SVT Models
- Year:** 2002-04
- Condition:** Worn motor mounts, motor strut, broken Converter mounting brackets
- Cause:** Broken Converter mounting brackets and worn motor mounts & struts leading to excessive strain and torquing of the front Catalytic Converter
- Solution:** Replace Converter mounting bracket & check motor mounts and struts for excessive movement
- Additional Help:** Available from Davico Technical Assistance at 800-422-6046
Additional information: TSB 05-14-12

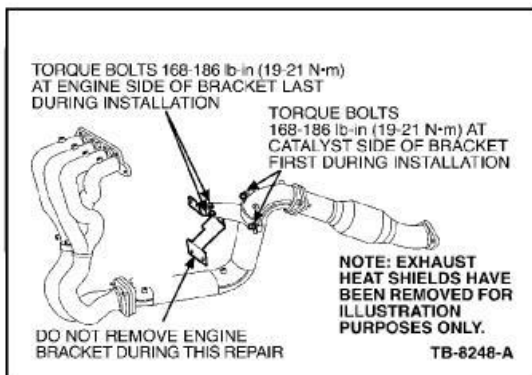


Figure 1